

TOP SECRET

1240Z 29 DEC 62

DIRECTOR

25X1A

OSA/TCO (1-2-3-4-5-6-7-8)

TOR: 1909Z 29 DEC 62

PRIORITY

25X1A

25X1A

25X1A

PRITY

PRITY

IN 60734

2622

3206

25X1A

FLS PASS

25X1A

25X1A

25X1A

25X1A

1. G-3226/11550/
2. ~~9L/0-11-6000/195-18-8-0/9R/0-11-6000/192-14-15-7-0~~  
9L/0-6000/189-9-10-1-2/9R/0-11-6000/185-4-5-2.
3. D-19/4/75 DEGREES/MTA-2
4. 2.3
5. FAIR TO GOOD/MEDIUM/GOOD/SEE PAR 6
6. TAKE RECEIVED 9350Z 28 DEC IN COVERED STEEL BOXES, CONDITION GOOD. VACUUM FAILURE FR.NR. 2944. COUNTER REPEAT THREE FRAMES NR. 2570. EMULSION SCRATCHES FR. 1136, 1194, 1196-99 R. FILM CREASES FR. NR 2647-50, 3387-3403 R. ONE INCH FILM TEAR FR. NR. 177R. FILM BREAK FR. NR. 2649-2650. DAMAGE DUE TO FAULTY OPERATION OF PROCESSOR DRY BOX. PRESSURE MARKS REFERRED TO IN

RPRT ON MSN 93203 DETERMINED TO BE FOG MARKS DUE TO LIGHT IN PROCESSOR. CAUSE HAS BEEN ELIMINATED. MARKED DECREASE IN WATER MARKS. IMPROVEMENT RESULT OF PHOTO-FLO DISTRIBUTION

25X1A

TOP SECRET

25X1A

TOP SECRET

☐ 2622 (IN 60734)

PAGE TWO

SYSTEM SUGGESTED BY EX PERSONNEL. ~~SISTUM TRANSMITTED ABOUT 29/1145Z~~

~~29 DEC 62.~~

~~7. NOT ACCOMPLISHED.~~

--END OF MESSAGE--

TOP SECRET